


# EASYSINK

Compact affordable solution for undermounts



Create sink cutouts both cut and polished with ease using the EASYSINK, this compact CNC machine was designed to simplify the task of doing sink cutouts at an affordable price.

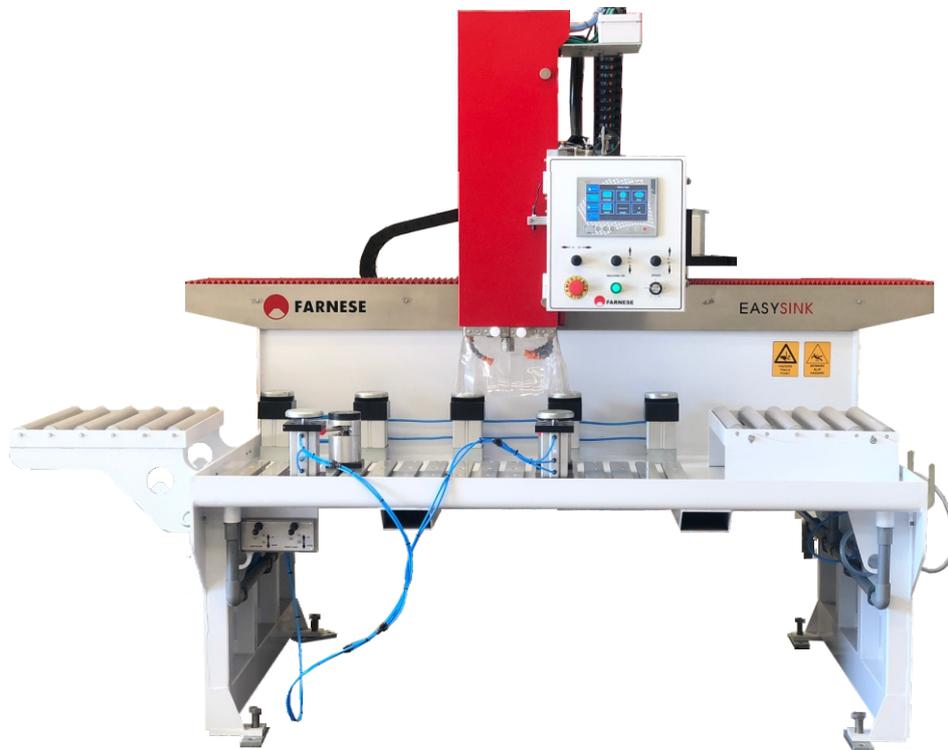

The EASYSINK comes with a user-friendly touch screen interface to machine sink cutouts parametrically. This EASYSINK allows you to machine non complicated shapes such as square, circles and oval shapes changing dimensions and the radius for corners with common sink templates, for other non standard shapes these can be supplied on demand.


Sink cutouts can be processed within the front and rear pneumatic clamps up to 1200 by 600mm on slabs over 3 metres long by 700mm. A laser indicator can help locate and position the centre of the cutout and the machine is also equipped with a manual tool changer, lubrication pump and takes up a small footprint, saving valuable space in your factory.



The team at Farnese Australia understands that buying stone machinery is an important decision, one that can be extremely costly when breakdowns occur and equipment doesn't run to its capability.

# EASYSINK

Compact affordable solution for undermounts

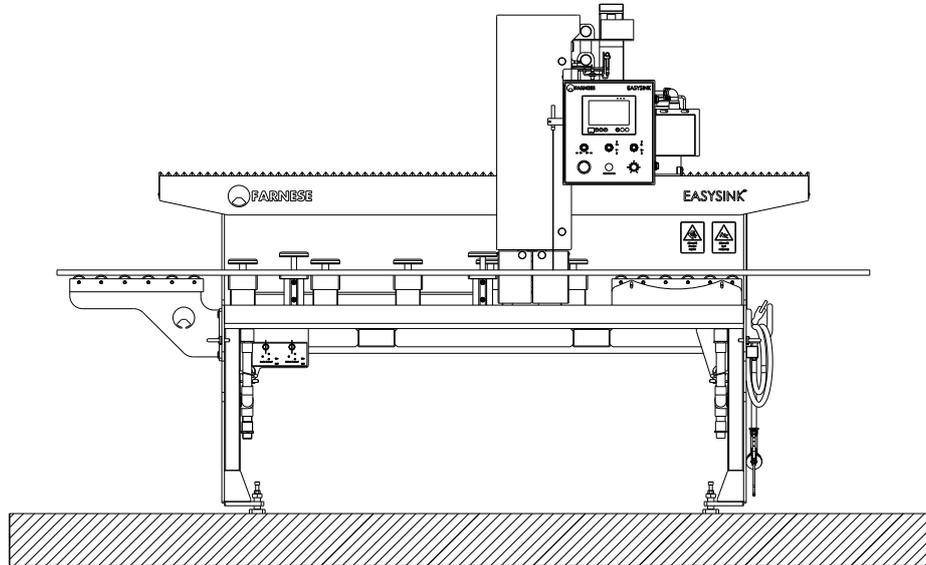

## TECHNICAL SPECIFICATIONS



### DIMENSIONS OF INSTALLED MACHINE

WIDTH	2800 mm	110.2 in
DEPTH	1900 mm	74.8 in
HEIGHT	2100 mm	82.7 in
WEIGHT	1500 kg	3300.0 lb

### FEATURES & FEEDS

CUTTING WIDTH (LONG TRAVEL STROKE)	600 mm	23.6 in
CUTTING DEPTH (CROSS TRAVEL STROKE)	1400 mm	55.1 in
CUTTING HEIGHT (HEAD UP AND DOWN)	200 mm	7.9 in
AIR PRESSURE (WORKING)	6 bar	87 psi
AIR PRESSURE (CONSUMPTION)	20 litres/min	
WATER (CONSUMPTION)	6.5 litres/min	(clear)
	50 litres/min	(recycled)
MAGAZINE	NO	
VACUUM CUPS	NO	
VACUUM GENERATOR	NO	
BACK CLAMPS	YES	5
FRONT CLAMPS	YES	2
AUTOMATIC GREASING	NO	
LASER CUTTING GUIDE	YES	
MICROSOFT WINDOWS COMPATIBLE	NO	
AUTOMATIC TOOL CHANGER	NO	
HANDWHEEL	NO	
MAIN SPINDLE POWER	6.6 kW	8.8 hp
MAIN SPINDLE SPEED (MIN & MAX)	500 rpm	6000 rpm
POWER REQUIRED	20A, 400V, 3 phases + Neutral	
	50A, 208V, 3 phases + Neutral	

\*CONNECTIONS REQUIRED (SUPPLIED BY CUSTOMER)

POWER, WATER, COMPRESSED AIR.

\*TOOLING

CONSULT YOUR LOCAL FARNESE DEALER FOR ANY TOOLING REQUIRED